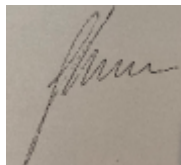



**Hurford Timbers - HM WALK MATTE SYDNEY BLUE GUM - Wet Sliptest
SN120220-7**

12 Feb 2020

Slip Resistance Classification of New Pedestrian Surfaces - AS4586:2013 Appendix A

| | |
|---------------------------------------|--|
| Date Tested: | 12 Feb 2020 |
| Test Report Number: | SN120220-7 |
| Client Name & Address: | Hurford Wholesale - 400 Jacobs Well Road, STAPYLTON QLD 4207 |
| Test Site / Surface Tested : | 136mm x 12.5mm - HM WALK MATTE - BLUE GUM |
| Sample Information : | Samples and Test Information Supplied by Client |
| Wet Pendulum Test carried out using : | Slider 96 (4S) Rubber slider |
| Record ambient temperature (°C) | 26 |
| Testing Officer : | Shenea Neill |
| Testing Officer : | #1133 - Munro-Stanley Portable Skid Tester #1133 - 31.10.2019 |
| Testing Officer Signatory: |  |

Test Results :

| Sample No. | Swing 1 | Swing 2 | Swing 3 | Swing 4 | Swing 5 | Mean BPN of last 3 swings : | Surface Picture |
|------------|---------|---------|---------|---------|---------|-----------------------------|---|
| SAMPLE 1 | 40 | 40 | 39 | 38 | 38 | 38 | |
| SAMPLE 2 | 38 | 37 | 37 | 37 | 37 | 37 | |
| SAMPLE 3 | 40 | 40 | 40 | 39 | 39 | 39 | |
| SAMPLE 4 | 38 | 38 | 38 | 38 | 38 | 38 | |
| SAMPLE 5 | 36 | 36 | 35 | 35 | 35 | 35 |  |

Mean BPN Slip Resistance Value (SRV)

37

CLASSIFICATION using Slider 96 (4S Slider)

P3 = 35 - 44

Accredited for Compliance with ISO/IEC 17025. The information presented herein and on the Sliptest Report is copyright and is protected by copyright law, any reproduction of this information and test report except in full is prohibited. Sliptest Australia Pty. Ltd. performed this on site test with reference to the following Australian Standard testing criteria, of AS 4586:2013 Classification of new pedestrian surface materials. Appendix A – Wet Pendulum Test Method and Hand Book HB 198: 2014 with reference to AS/NZS 4663: 2004 Slip Resistance measurement of existing pedestrian surfaces and HB 197: 1999. These results do not account for Future Wear, Maintenance or Contamination of this surface once in-situ.

